



Service Hint

C521/C541

C522/C524

C520/C540

If the customer has a complaint about a CD Player not being able to play a CDR or out of tolerance discs, try replacing these capacitors with the following values. This will also provide a cure on some players for "NO DISC" message.

C520/C521 /C522/C524

C540/C541

C122 is changed to 2.7pF

C122 is changed to 2.7pF

C123 is changed to 0.01uF

C123 is changed to 0.01uF

C124 is changed to 22pF

C124 is changed to 22pF

C311 is changed to 220pF

Production:

This change has been implemented in production from serial number:

G19C52113901 - C521/C

G19C54108101 – C541/AH

G19C54108401 – C541/C

Contact:

NAD Electronics International

633 Granite Court

Pickering, ON Canada L1K 3K1

Voice: 905-831-0799 FAX 905-837-6357

www.nadelectronics.com