

Published by:
Service Department Audio Systems



LINE OF BUSINESS AUDIO SYSTEMS

SERVICE NEWSLETTER

06.01 TYPENUMBER(S): **CD713, CD723, CD753**

INFORMATION : Above mentioned sets use CD-Short Loader MK3.
This module is equipped with CD-drive **VAM1201** – 4822 691 10615.
Based on repair feedback it has been found that sometimes the
VAM1201 is replaced by CDM12.1 – 4822 691 30278.

**Although drives seem to be identical, it is not allowed to replace
VAM1201 by CDM12.1. The higher clamping force of the CDM12.1
might cause problems during open/close.**

REMARKS :

06.02 TYPENUMBER(S): **FW399V**

SYMPTOM : **IRIS CODE 1 3 5 X**
Pictures skip and jump when playing a Video-CD.

CURE : The problem can be solved by the following modification on the
Servo Board:
1. Add elcap 2861 22µF 16V (4822 124 41796) into the location
provided on the printed board
2. Replace bare wire 9015 with resistor 3872 47Ω (4822 116 52195)

REMARKS :

06.03 TYPENUMBER(S): **FW399V/21/21M**

SYMPTOM : **IRIS CODE C 5 1 X**
Sometimes the set does not read the TOC of some critical CDs.
“NO DISC” is shown on the display.

CURE : The problem can be solved by the following modification on the
Main Combi Board:
1. Delete elcap 2342 100µF 10V

REMARKS : Above modification is implemented in production from week 9932
onwards.