

Technical BulletinProduct : **Azur 840C and 740C CD players**

Page 1 of 1

Fault Symptom:

Low gain or no audio output on one or both channels. C270 on the 840C , or C5 on the 740C DAC PCB may be visibly damaged (top pushed up). Relays RL1, 2, 3 may not close.

Cause:

The unregulated 10V supply on these DAC boards is smoothed by a 470uF capacitor, rated at 16V. High mains spikes and supply fluctuations can cause premature failure of the capacitor.

Solution:

Replace this capacitor with the same value, but rated at 35V.

We advise that you make this modification to all service returns.

n.b. Production from September 2008 will be revised.