



2/28/2003

Errata: CDB8416 Rev. B Evaluation Board

(Reference CDB8416 Data Sheet revision DS578DB2 dated Oct '02)

- In Software Mode, the PC control port implementation on the board does not allow for I²C read operation from the CS8406. CS8406 register read and write operation can be performed through SPI communication.
- The CS8416 external PLL component values on the board have changed from what is indicated in the schematic to reflect the current recommended component values. The correct values are:
 - R59=3 kΩ (Rflt)
 - C57=22 nF (Cflt)
 - C58=1 nF (Crip)

Contacting Cirrus Logic Support

For all product questions and inquiries contact a Cirrus Logic Sales Representative.
To find one nearest you go to www.cirrus.com