

Model: DR4050/DR6000/DR6050CDR500/CDR631

Subject: Improvement for inoperable all buttons

Symptom: While CD is playing or CD-R/RW is recorded, the FL display freezes and all buttons except the POWER button will not work.

Solution: Replace the DASP IC <IC 7701> with the improved version.

Parts:

Ref#	Description	Part Number
7701	DASP IC	QC05603460

Applicable Lot Number Range:

DR4050: 01 - 11, DR6000: 01 - 16, DR6050: 01 - 12, CDR500: 01 - 10, CDR631: 01 - 14.

This improvement has been done in production after:

LOT number "12" and later. (DR4050)

LOT number "17" and later. (DR6000)

LOT number "13" and later. (DR6050)

LOT number "11" and later. (CDR500)

LOT number "15" and later. (CDR631)

The lot number and the service modification code are mentioned in the serial number label on the rear panel. (ex. MZxxxxxx12xxxx).