

<div>marantz®</div> <div>SERVICE BULLETIN</div>		Date: 17-Jul.-2002	Model: PM4200
		Page: 1/2	REF.NBR: MZ02-009revision
		Subject: Problem with incorrect operation of MUTE.	
Circulation:	Application:	Int.ref:	
x for information customer complaint in case of service mandatory	See below		

[PHENOMENON]

The MUTE LED sometimes blinks and the sounds from output intermit.

[CAUSE]

Contact error between the bracket (Pos. No. 30) and the ground of INPUT/AMPLIFIER PCB (Pos. No. 29).

[SOLUTION]

(Revision)

Repair work was changed. This work is done without removing a circuit board.

Contact to the ground certainly by the wire with the lug.

Please refer to the processing figure of the next page and correct.

[NECESSARY PART]

The wire with the lug: (MJI Part No. YB00091620 or similar product)

[REMARKS]

This improvement has been done in the production line after.



The serial number MZ000149006651 and later. (PM4200/N1B/N2B)

The week code number MZxx0203xxxxxx and later. (PM4200/N1G/N2G)

Approved by **M.KIMURA**

Written by **S.NAGAO**

Processing figure (Part side view)

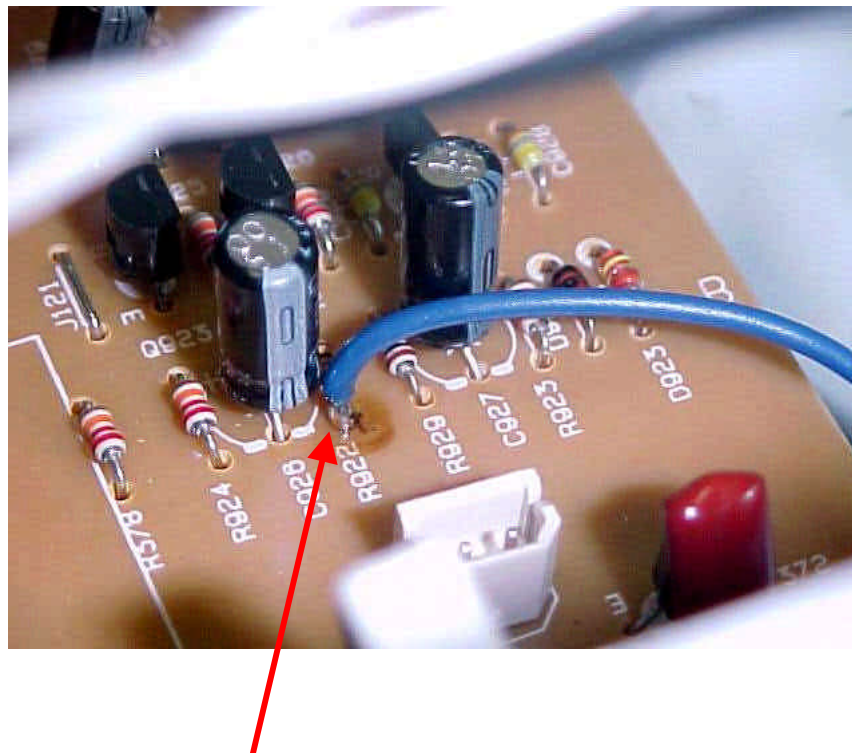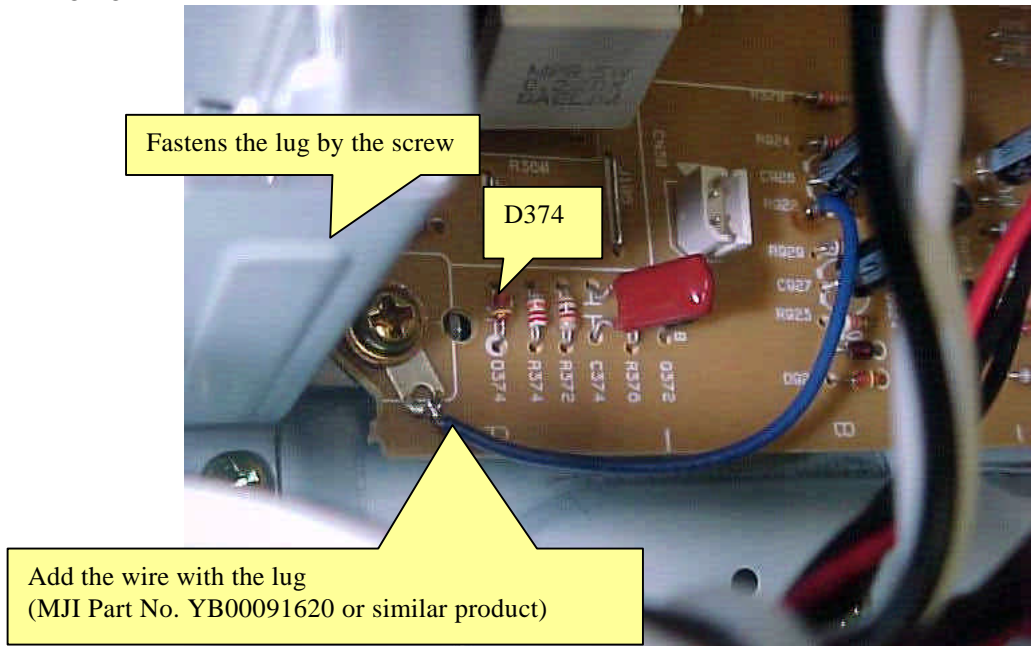

Solder the wire to the ground side lead of the R922 or R929