

Hi-Fi Products Service Bulletin

CSA-13

Sony Service Company - Technical Services
A Division of Sony Electronics Inc.
Sony Drive, Park Ridge, New Jersey 07656

Model: GEN-HFP

No. 428

Subject: A Whistling noise is heard when playing certain Discs.

Date: February 1, 1995

Symptom:
(64)

A whistling noise can be heard from the mechanical assembly. The whistling noise is a result of vibration of the disc, optical lens, and BU base which results in an audible resonant frequency. The following modification is applicable to all units that use the KSS-240A optics and exhibit the audible noise.

Solution:

To reduce the vibration of the BU base add the weight (P/N 4-962-979-01) to the optical block using a +PTP2.6X8 screw (P/N 7-685-134-19) in place of the original screw.



