

PV 1.3k Predriver Replacement

The C2238B (70415030) and A968B (70415031) predrivers have been replaced with 15032 (70415032) and 15033 (70415033) higher-current devices. Three resistor changes per drive board are required to utilize these parts. Note any unit in for repair should have the new parts installed to improve reliability.

- 1- Replace 70415030 (Q100, Q200) with 70415032
- 2- Replace 70415031 (Q104, Q204) with 70415033
- 3- Change R110, R210 10 ohm to 33 ohm (70240004)
- 4- Change R102, R127, R202, R227 from 1.5k to 4.7k (70240023)

