

THE GREAT AMERICAN SOUND COMPANY

DECEMBER 8, 1977

SERVICE TECHNICAL BULLETIN

NO. 36

MODEL TEALIA (801)

SYMPTOMS

NOTED

When pushing Channel A bottom Mode Switch, Channel B is heard; when pushing Channel B bottom Mode Switch, Channel A is heard.

PROBLEM

Reversed connections to Mode Switches.

REMEDY

Interchange connections on Switch PC Board.

PARTS

REQUIRED


Two (2) 0.5" jumpers with sleeving.

PROCEDURE

1. Remove top cover and place at side of unit.
2. Refer to pictorial supplied for location of switching PC Board #322 circuitry.
 - A. Cut foil at points 1 and 2.
 - B. Add jumpers between points C and E, and points D and F.
 - C. Interchange the wires between points A and B.
3. Replace top cover.
4. Turn on unit and check for proper operation.


NOTE: Serial Numbers affected are all units prior to S/N 801400.

CORRECT WIRE COLOR SHOWN

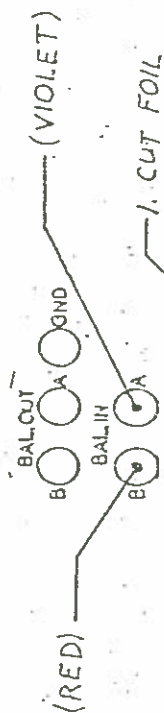

MADE IN USA COPYRIGHT 1977

U22U

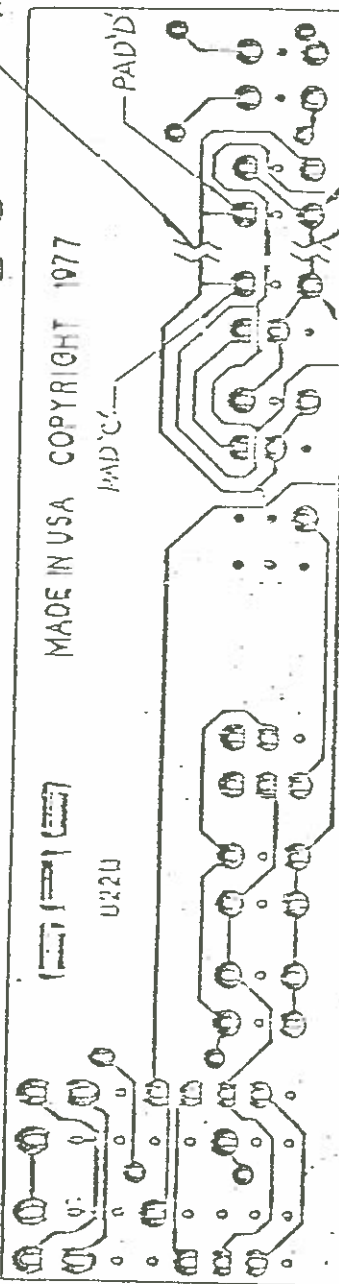

JUMPERS : C TO E
D TO F



GREAT AMERICAN SOUND
20940 LASSEN ST.
CHATSWORTH CALIF. 91311